




Ozeri Pronto ZK14-S LCD Motherboard Replacement

Replace the LCD Motherboard to view the weight readings on the device.

Written By: Oneika White

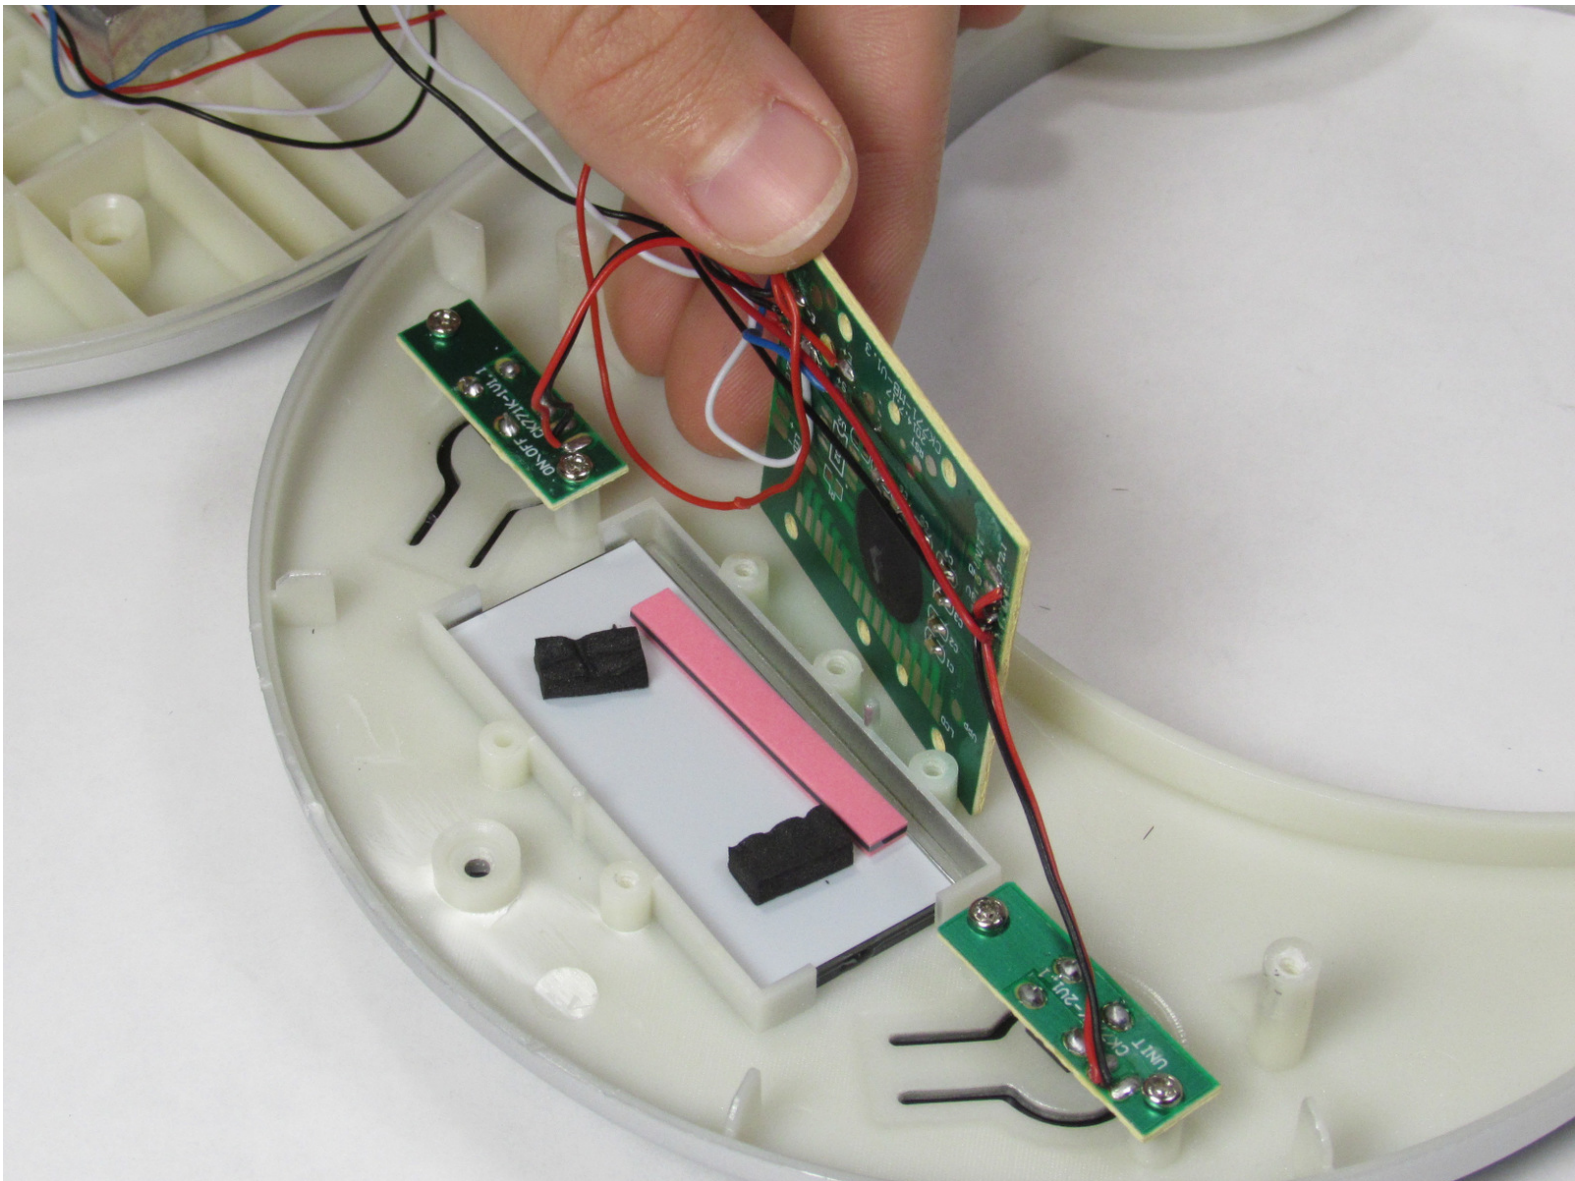

INTRODUCTION

This guide explains how to expose detach the remove the LCD motherboard of the Ozeri Pronto ZK14-S. Assistance may be necessary if you do not feel confident about using the iOpener. A soldering iron will be necessary to remove the wires from the motherboard. Please view the following link for detailed instructions on how to operate a soldering iron: [How To Solder and Desolder Connections](#)



TOOLS:

- [2.0 Flathead screwdriver](#) (1)
 - [iOpener](#) (1)
-

Step 1 — Panel Removal



- Twist the plastic plate slowly to the left to pull it away.

Step 2




- Pry off the sticker at the bottom where the “Ozeri” logo is to reveal a screw. The sticker does not need to be completely removed for the next step.

Step 3





- Using the 2.0 Flathead screwdriver, remove the 9.50 mm Phillips head screw under the sticker.

Step 4

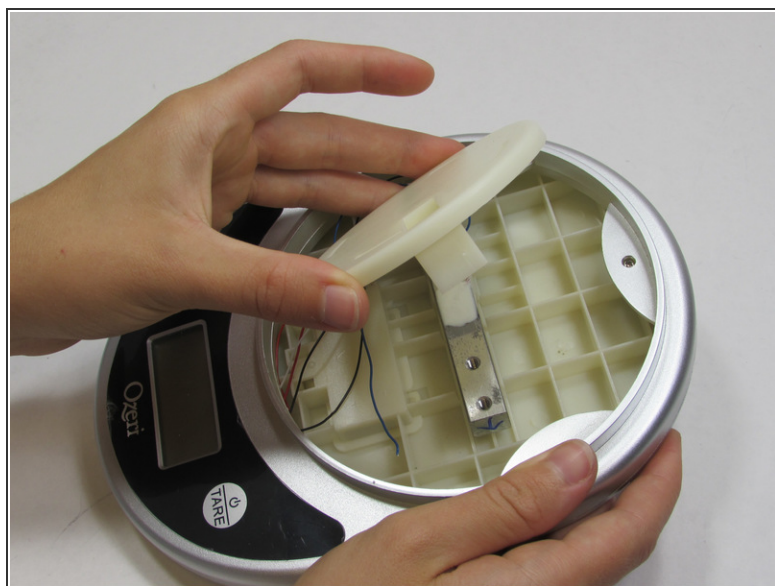

- Using the 2.0 Flathead screwdriver, remove the two 18.76 mm Phillips head screws in the plate stand.

Step 5

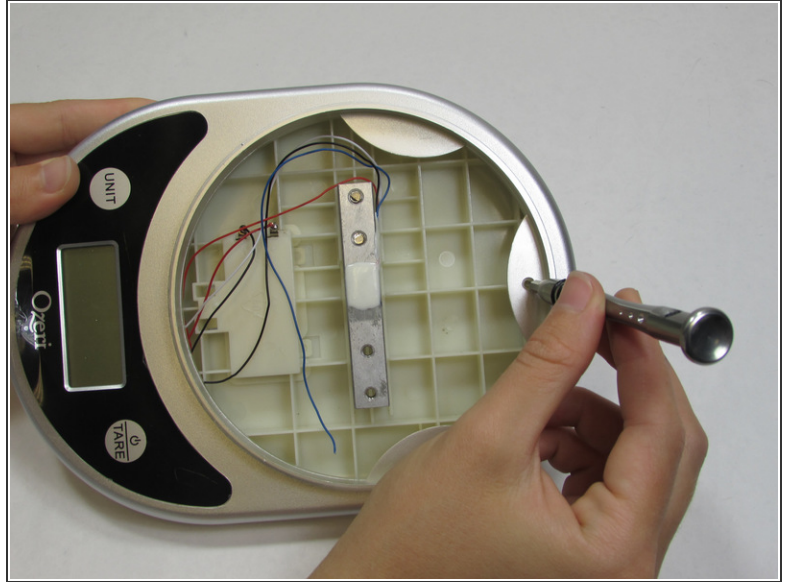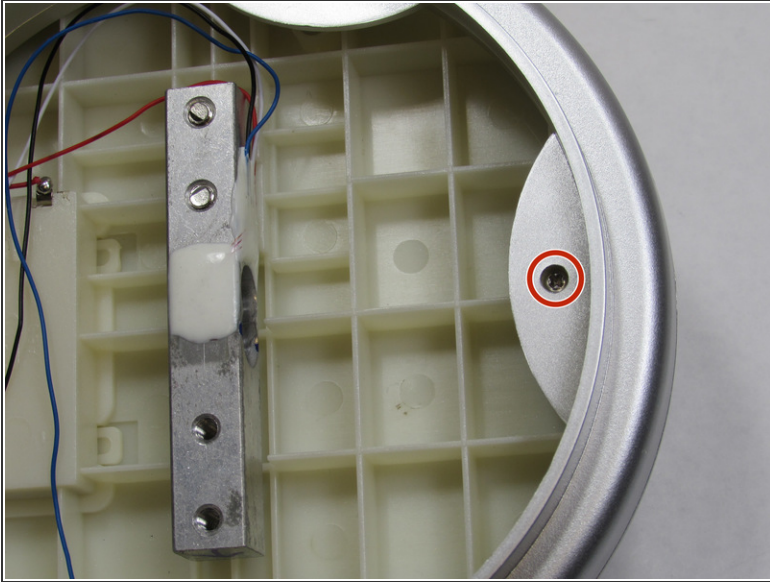

- Using the 2.0 Flathead screwdriver, remove the 9.44 mm Phillips head screw on the end opposite of the LCD screen.

Step 6



- Turn the device over so the back panel is facing up.

Step 7




- Using the plastic opening tool, pry off each of the two rubber stubs on the right side and the two stubs on the left side of bottom of the device.

Step 8




- Using the 2.0 Flathead screwdriver, remove of the four 9.46 mm Phillips head screws under the removed stubs.

Step 9

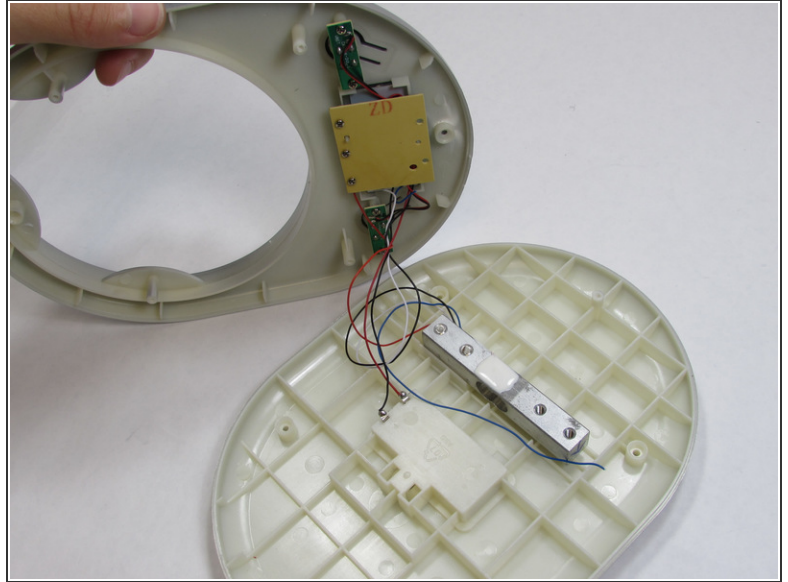


- Pry apart the two panels to separate them from each other.
- Flip the device over so the LCD is facing up. Flip the front panel over on its side.
- ⚠ Be careful when separating the panels to avoid damaging the wires they are connected by.

Step 10 — LCD Motherboard

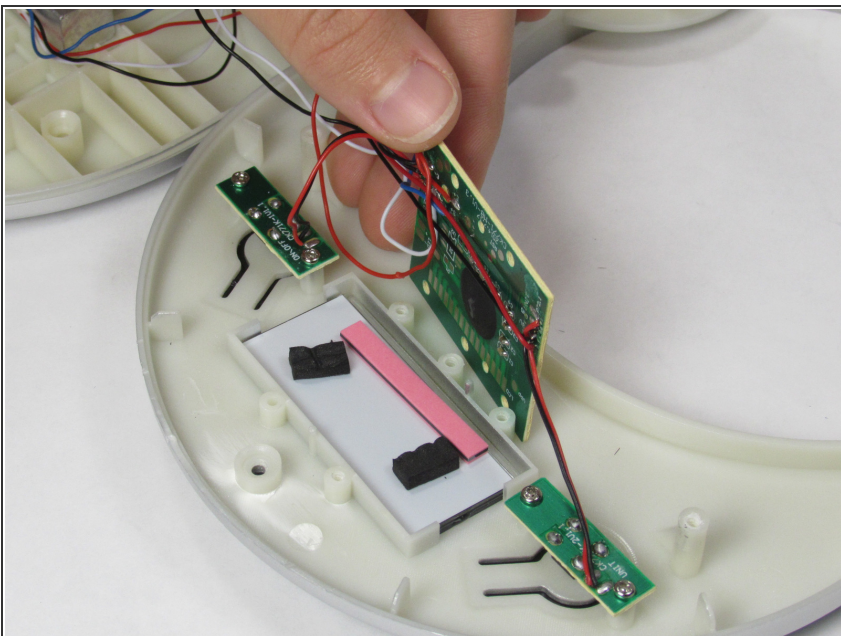

- Stand the center motherboard up.
- ⚠ Be careful when standing up the LCD motherboard to avoid damaging the wires it is connected to.

Step 11

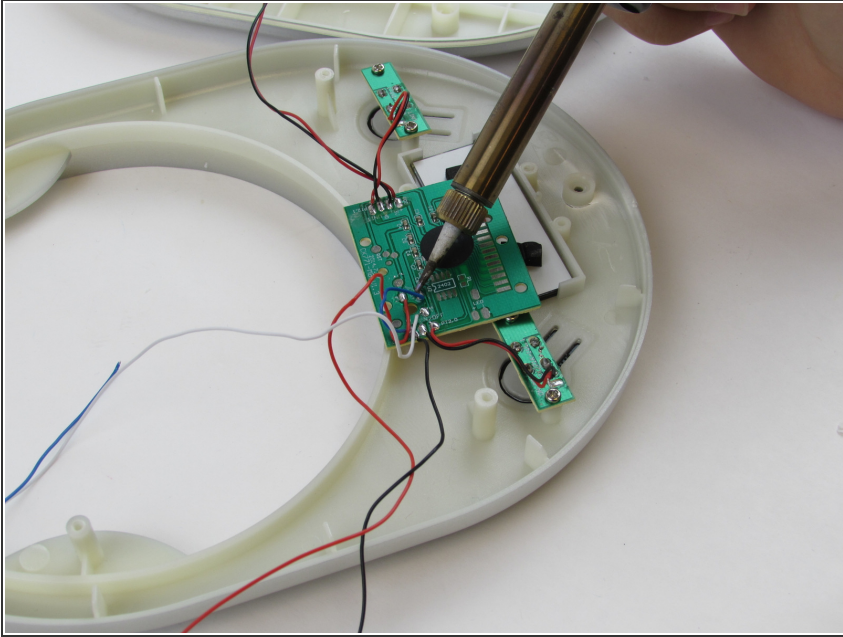

- Unsolder the posts to remove the wires
- ⓘ Repeat this step to remove the other two motherboards

To reassemble your device, follow these instructions in reverse order.

This document was last generated on 2017-06-27 03:08:01 AM.